


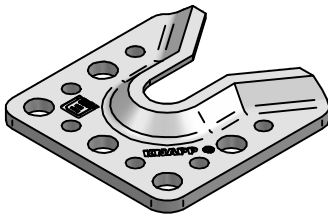

ETA-10/0189

WALCO® V 80

Wall connector




Collar screw 16x60 mm
Art. - No. K103




WALCO V 80



1. Drilling

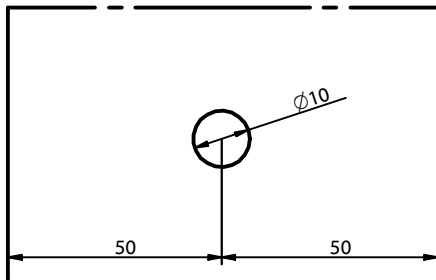


2. Screwing collar screw

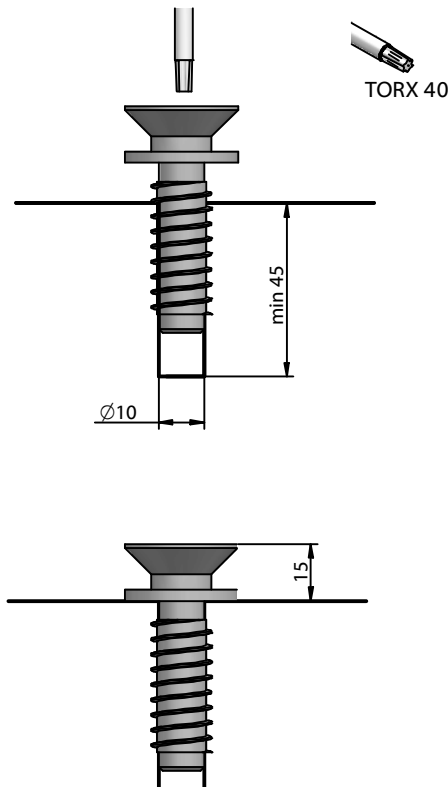

Tip: If the collar screw requires a higher height, one additional washer can be laid under the collar screw washer.


1. Machined edge

Minimum milled dimension:

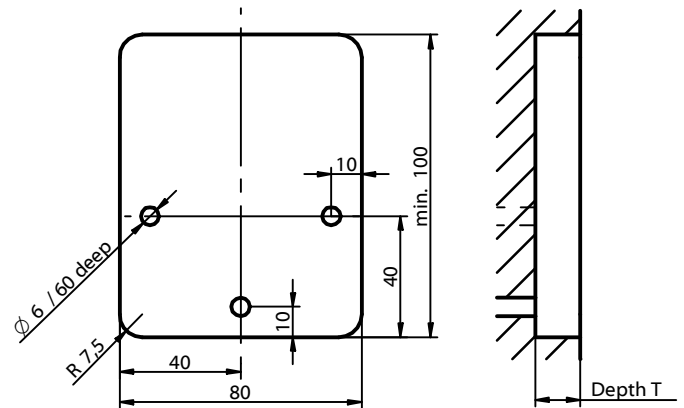


Holding screw	Depth T
Collar Screw	15 mm without joints => tight fitting
Retaining holding screw	13 - 24 mm
Retaining spring holding screw	13- 17 mm

2. Marking Connector position with scribing jig

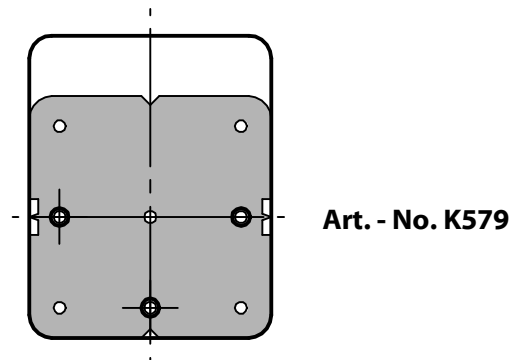


3. Assemble connector

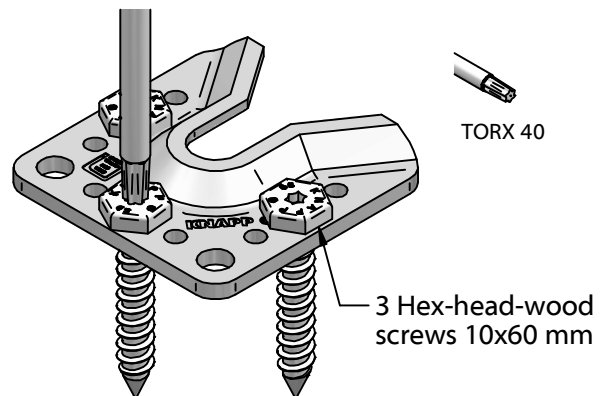

This drawing is the exclusive property of Knapp GmbH.

© Knapp GmbH. All measures in mm - Errors excepted. VERSION 24.05.2018

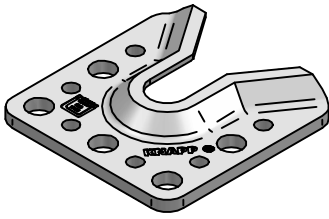

ETA-10/0189


Instruction Manual WALCO® V 80

Wall connector


Retaining spring holding screw M16
Art. - No. K107




1. Drilling

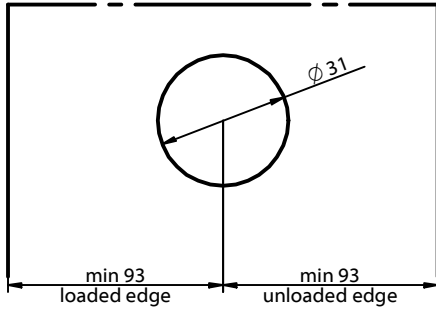

2. Screwing the insert screw with special tool

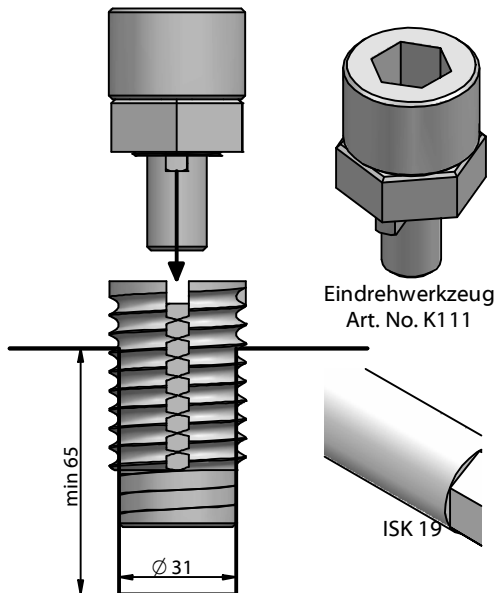


3. Screwing holding screw and adjustment of height

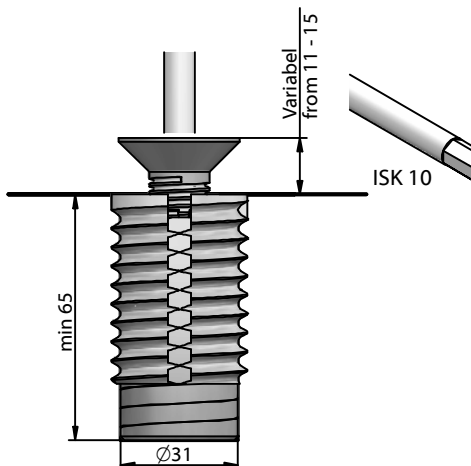


Retaining holding screw M16
Art. - No. K105




1. Drilling the two holes

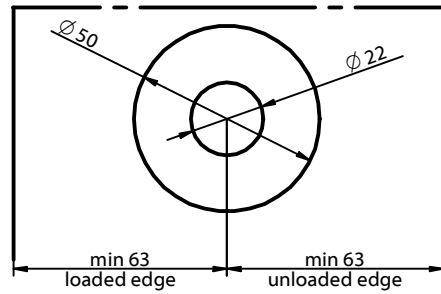


2. Screwing insert screw

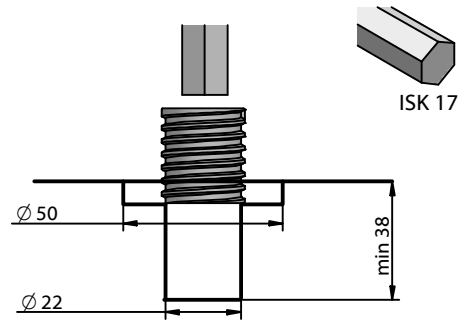

3. Screwing retaining holding screw and nut M16

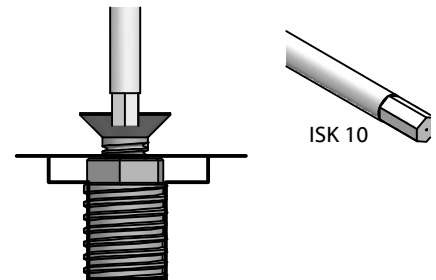


4. Fixing the screw and nut in the ideal position

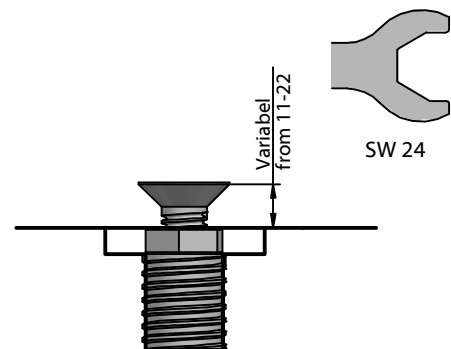

This drawing is the exclusive property of Knapp GmbH.

© Knapp GmbH. All measures in mm - Errors excepted. VERSION 24.05.2018

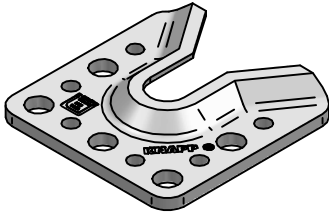

Instruction Manual

WALCO® V 80 VK D16

Wall connector


Collar bold holding screw
Art. - No. K109




WALCO V 80



1. Drilling

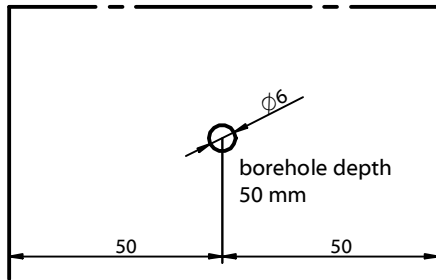


2. Screwing countersunk screw into Collar bolt

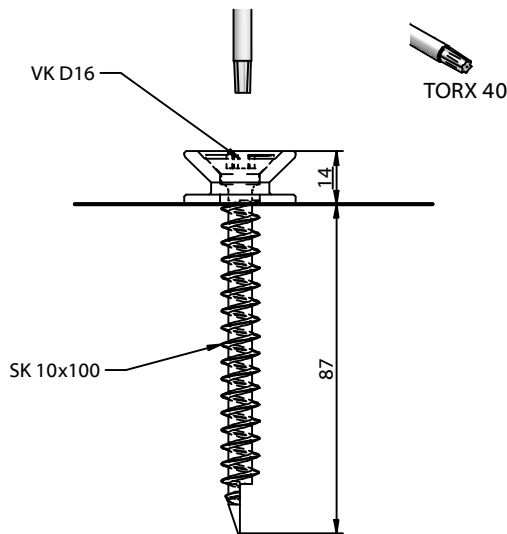

Tip: If the collar bold holding screw requires a higher height, one additional washer can be laid under the collar screw washer.
The full thread screw can be pre drilled with a $\phi 7$ mm diameter.


1. Machined edge

Minimum milled dimension

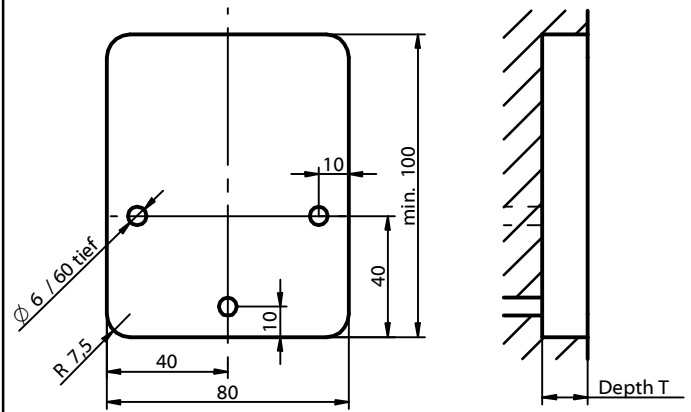



Depth T: 15 mm without joints => tight fitting
13 mm easy to connect (2mm gap)

2. Marking Connector position with scribing jig

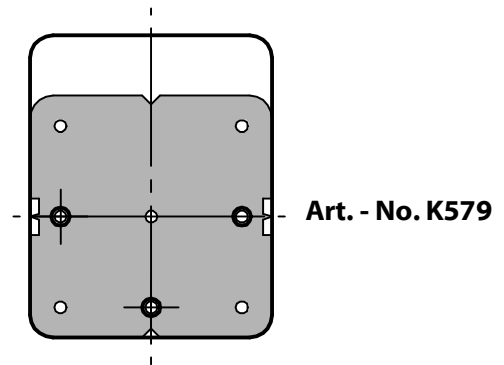

3. Assemble connector

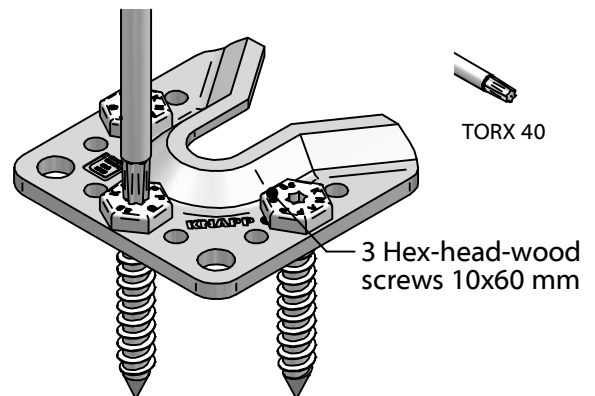



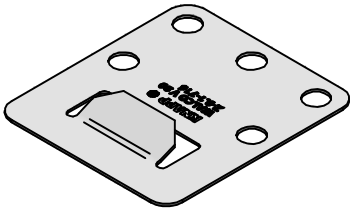


WALCO® V 80


Wall connector with clip lock

WALCO V Clip lock
Art. - No. K113

WALCO V 80

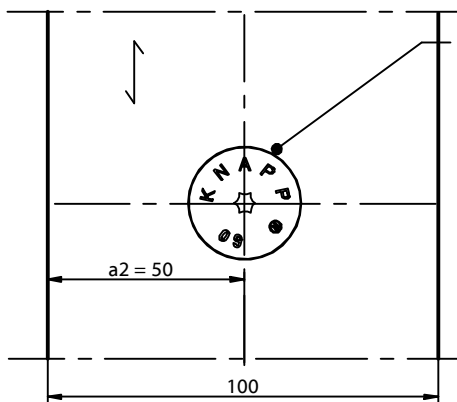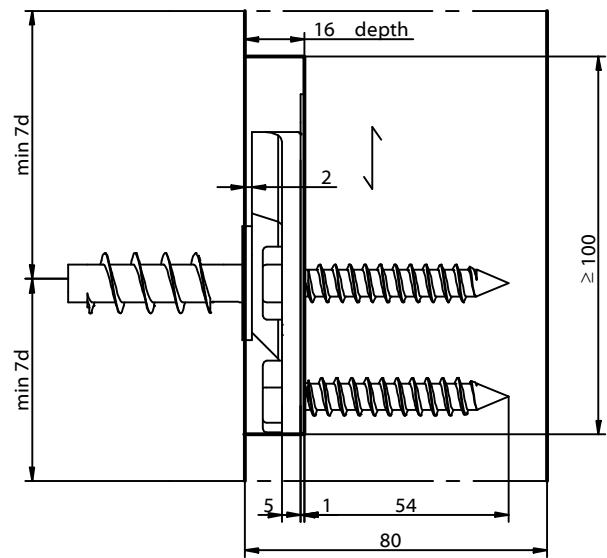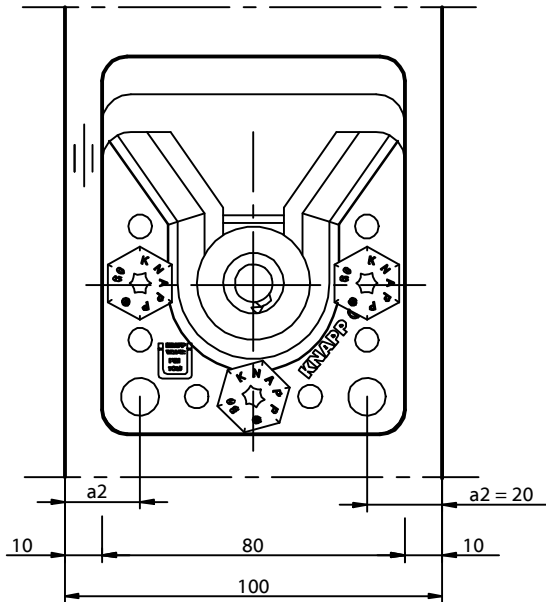




Collar screw 16x60 mm

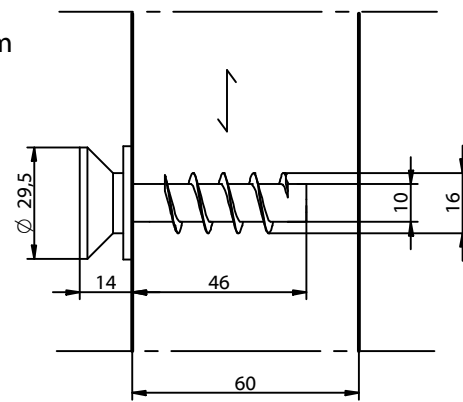

1. Positioning


2. Insertion

3. Locking

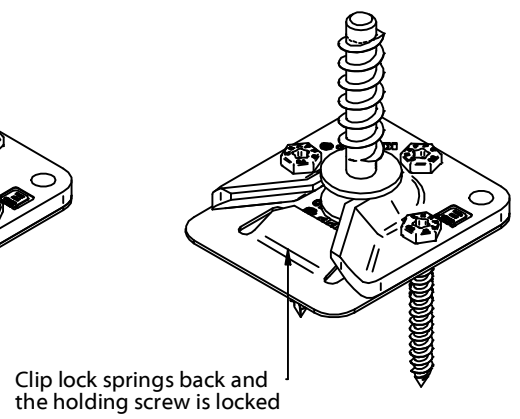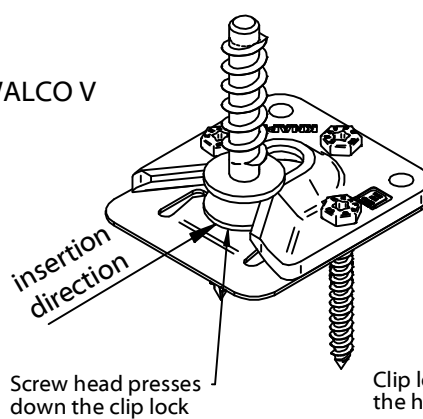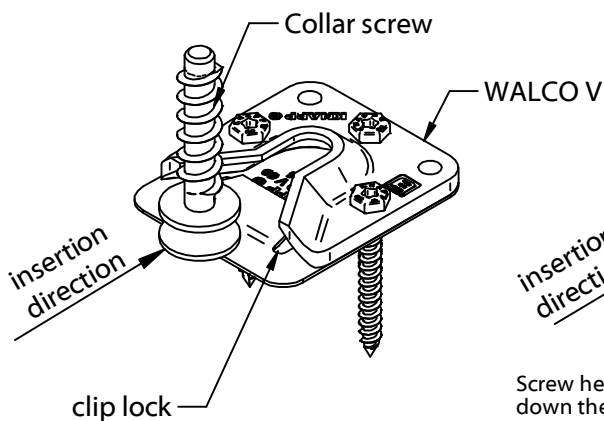

This drawing is the exclusive property of Knapp GmbH.

© Knapp GmbH. All measures in mm - Errors excepted. VERSION 24.05.2018

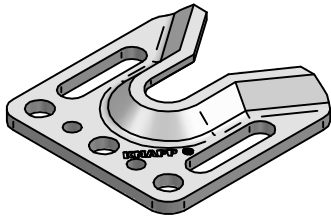

WALCO® V 80 Oblong hole KS

Wall connector


Collar screw 16x60 mm
Art. - No. K115




WALCO V 80



1. Drilling

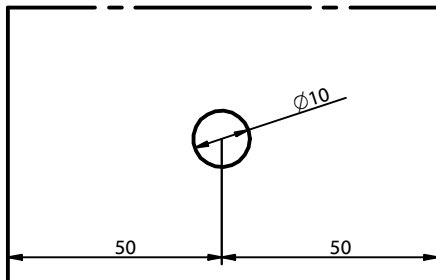


2. Screwing collar screw

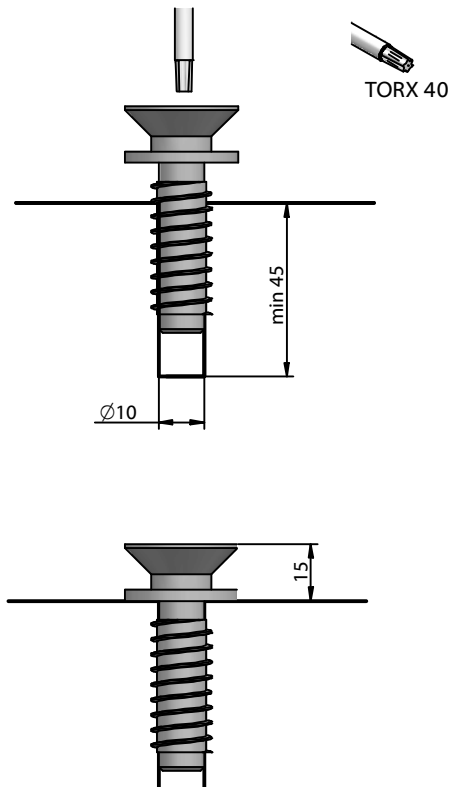

Tip: If the collar screw requires a higher height, one additional washer can be laid under the collar screw washer.


1. Machined edge

Minimum milled dimension:

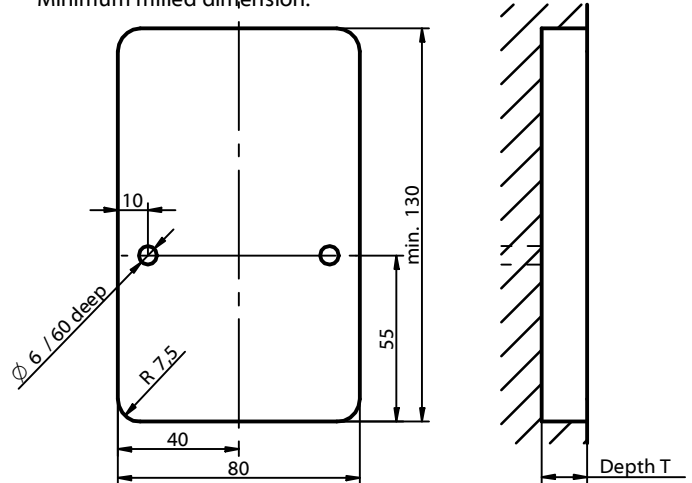



Holding screw	Depth T
Collar Screw	15 mm without joints => tight fitting
Retaining holding screw	13 - 24 mm
Retaining spring holding screw	13- 17 mm

2. Marking Connector position with scribing jig

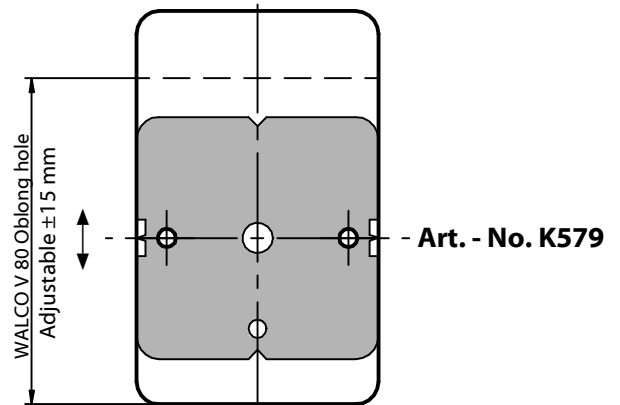

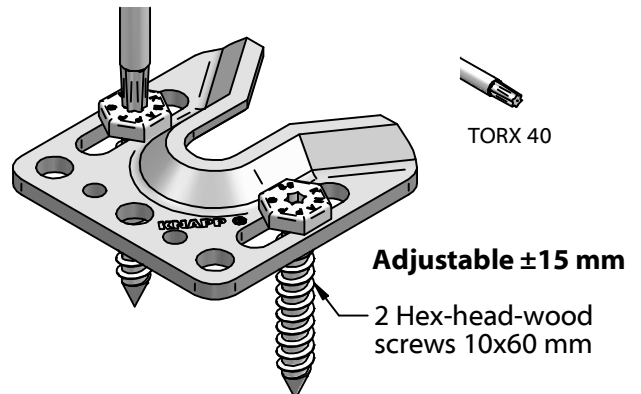






3. Assemble connector

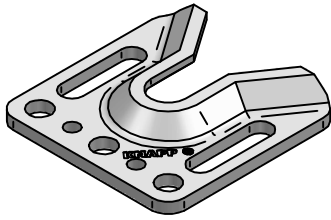




WALCO® V 80 Oblong hole VK

Wall connector
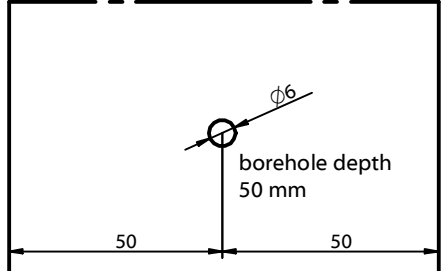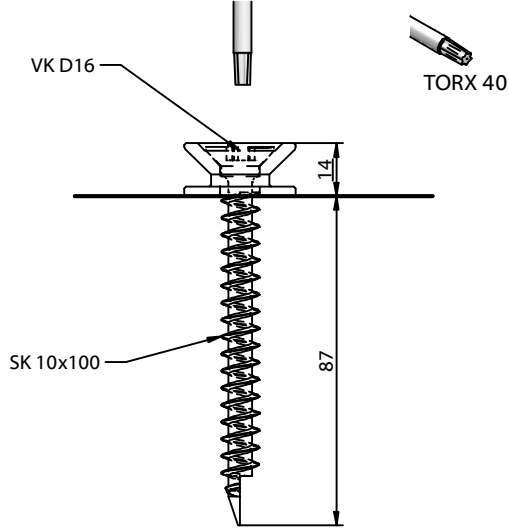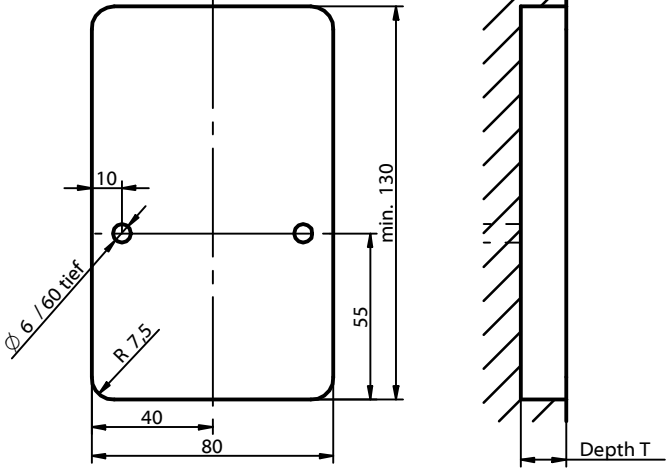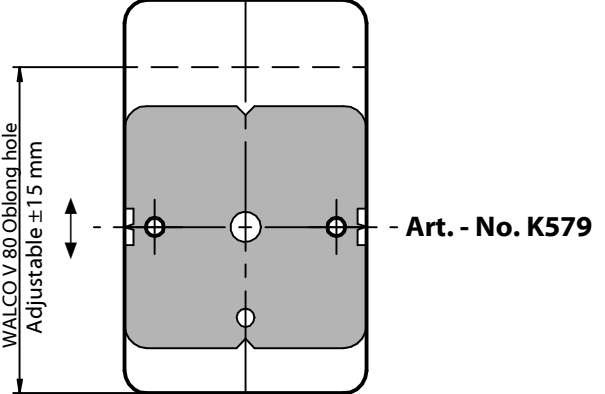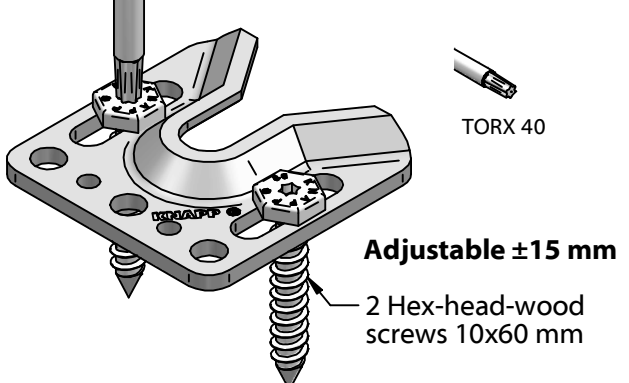
<p>Collar bold holding screw Art. - No. K116</p> 	<p>WALCO V 80</p> 
<p>1. Drilling</p>  <p>borehole depth 50 mm</p> <p>$\phi 6$</p> <p>50 50</p> <p>2. Screwing countersink screw into Collar bolt</p>  <p>VKD16</p> <p>TORX 40</p> <p>14</p> <p>87</p> <p>SK 10x100</p> <p>Tip: If the collar bold holding screw requires a higher height, one additional washer can be laid under the collar screw washer. The full thread screw can be pre drilled with a $\phi 7$ mm diameter.</p>	<p>1. Machined edge Minimum milled dimension:</p>  <p>10</p> <p>$\phi 6 / 60$ tief</p> <p>R 7.5</p> <p>40</p> <p>80</p> <p>55</p> <p>min. 130</p> <p>Depth T</p> <p>Depth T: 15 mm without joints => tight fitting 13 mm easy to connect (2mm gap)</p> <p>2. Marking Connector position with scribing jig</p>  <p>WALCO V 80 Oblong hole Adjustable ± 15 mm</p> <p>Art. - No. K579</p> <p>3. Assemble connector</p>  <p>TORX 40</p> <p>Adjustable ± 15 mm</p> <p>2 Hex-head-wood screws 10x60 mm</p>

This drawing is the exclusive property of Knapp GmbH.

© Knapp GmbH. All measures in mm - Errors excepted. VERSION 24.05.2018

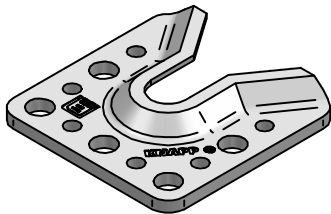

ETA-10/0189

WALCO® 80 VS / V80

Wall connector


WALCO 80 VS

Art. - No. K711/Set




1. Machined edge

Minimum milled dimension

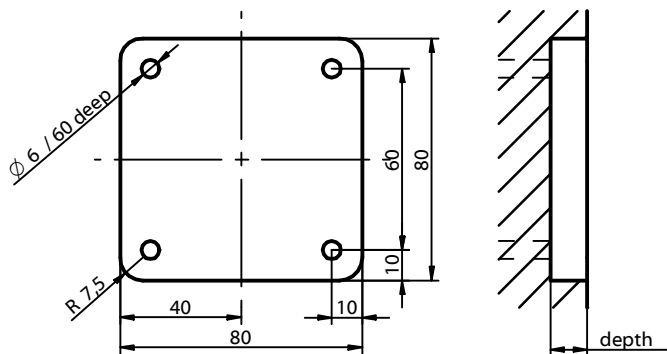


Milling depth at two-sided cut-out:
12 mm

2. Marking connector position with scribing jig

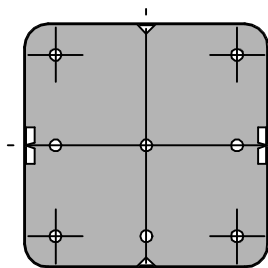

Art. - No. K579

3. Assemble connector

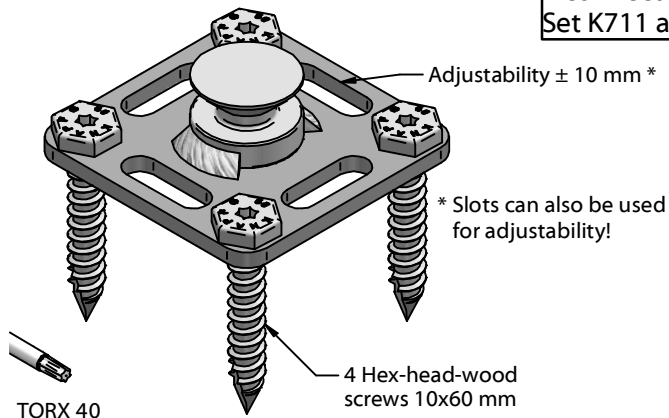

1 connection contains
Set K711 and Set K101

WALCO V 80


Art. - No. K101/Set



1. Machined edge

Minimum milled dimension


* at one-sided cut-out
** at two-sided cut-out

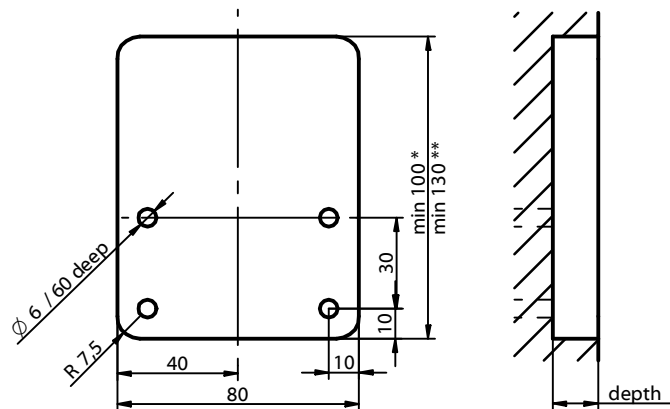

Milling depth at two-sided cut-out:
15 mm without joint => tight fitting
13 mm easy to connect (2 mm gap)


Milling depth at one-sided cut-out:
27 mm without joint => tight fitting
25 mm easy to connect (2 mm gap)

2. Marking connector position with scribing jig

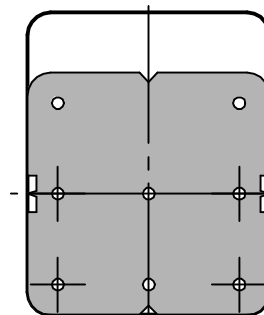


Art. - No. K579

3. Assemble connector

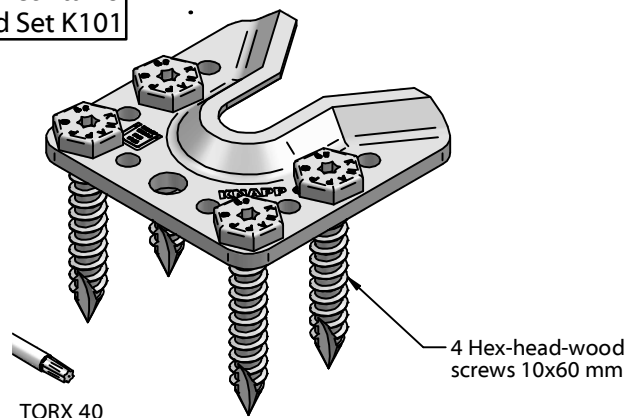

This drawing is the exclusive property of Knapp GmbH.

© Knapp GmbH. All measures in mm - Errors excepted. VERSION 08.08.2018

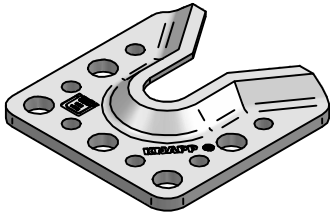


WALCO® 80 VK / V80

Wall connector


WALCO 80 VK

 Art. - No. K710/Set




1. Machined edge

Minimum milled dimension

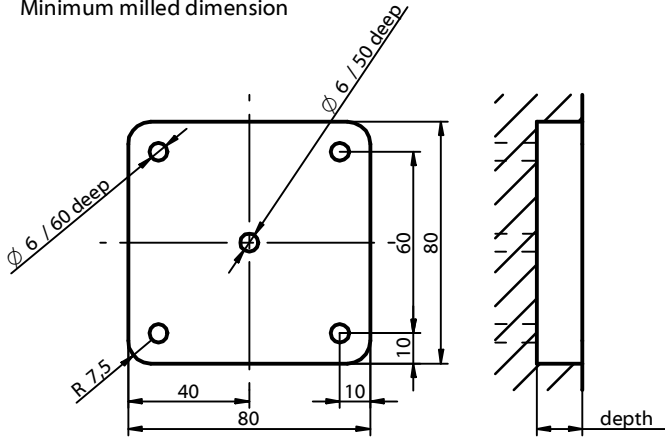


Milling depth at two-sided cut-out:
12 mm

2. Marking connector position with scribing jig

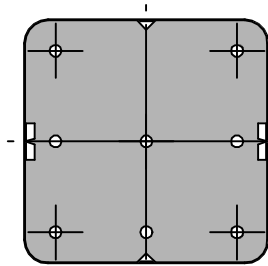

Art. - No. K579

3. Assemble connector

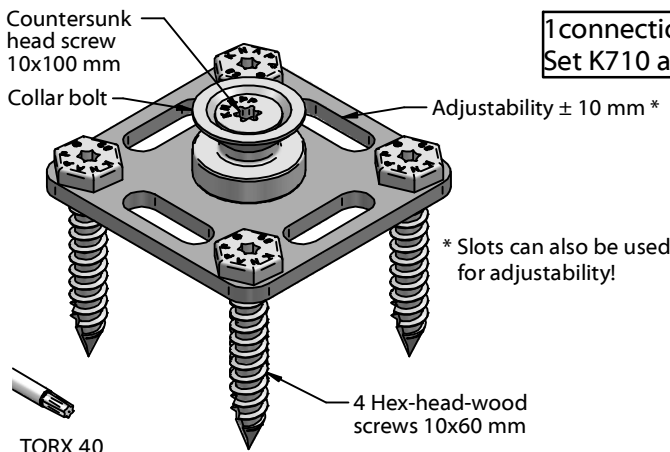

* Slots can also be used for adjustability!

TORX 40

WALCO V 80


Art. - No. K101/Set



1. Machined edge

Minimum milled dimension


* at one-sided cut-out
** at two-sided cut-out

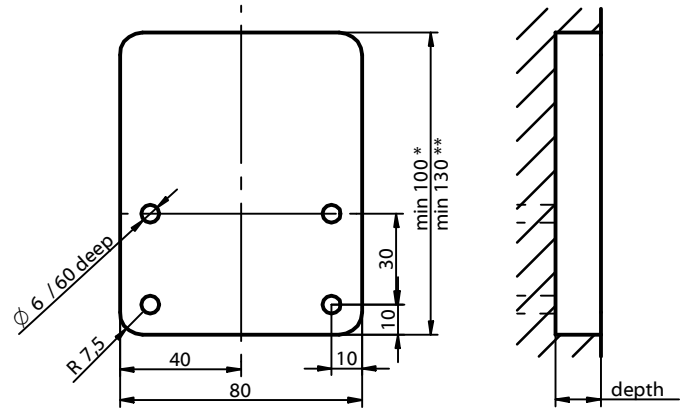

Milling depth at two-sided cut-out:
15 mm without joint => tight fitting
13 mm easy to connect (2 mm gap)


Milling depth at one-sided cut-out:
27 mm without joint => tight fitting
25 mm easy to connect (2 mm gap)

2. Marking connector position with scribing jig

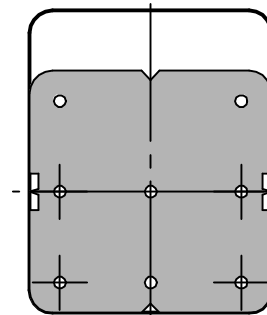

Art. - No. K579

3. Assemble connector

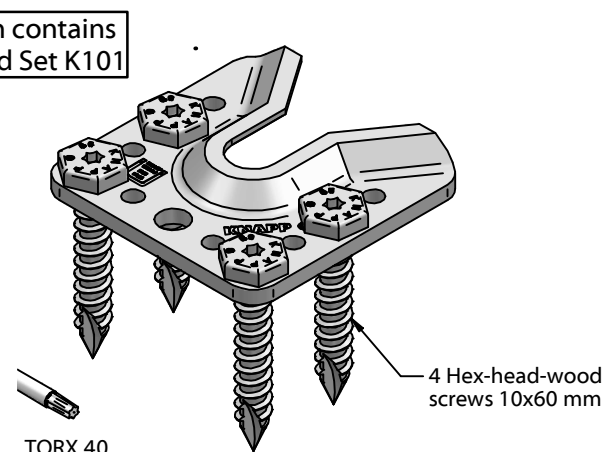


TORX 40

1 connection contains
Set K710 and Set K101

This drawing is the exclusive property of Knapp GmbH.

© Knapp GmbH. All measures in mm - Errors excepted. VERSION 08.08.2018

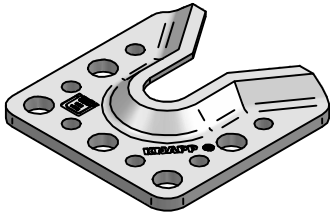


WALCO® 80 M16 / V80

Wall connector for curtain wall


WALCO 80 M16

 Art. - No. K712/Set



1. Machined edge


Minimum milled dimension

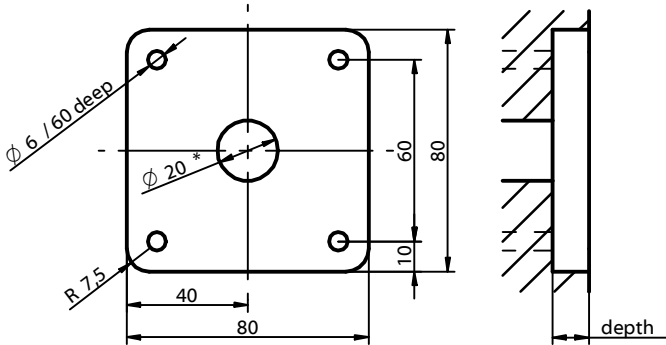

Cutting depth can be selected as required or screw on flat


*... Adjust the drilling depth to the adjustment range / length of the screw!

2. Marking connector position with scribing jig

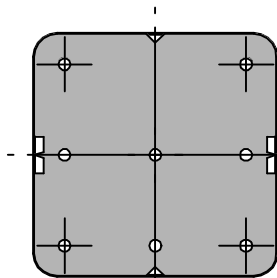


Art. - No. K579

3. Assemble connector

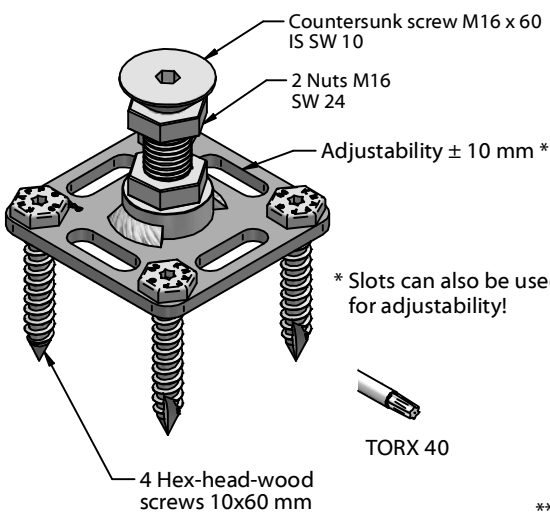

1 connection contains Set K712 and Set K101

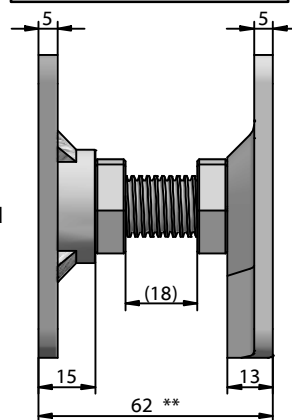

**... dimension example refers to countersunk screw M16 x 60 mm


WALCO V 80

Art. - No. K101/Set




1. Machined edge

Minimum milled dimension

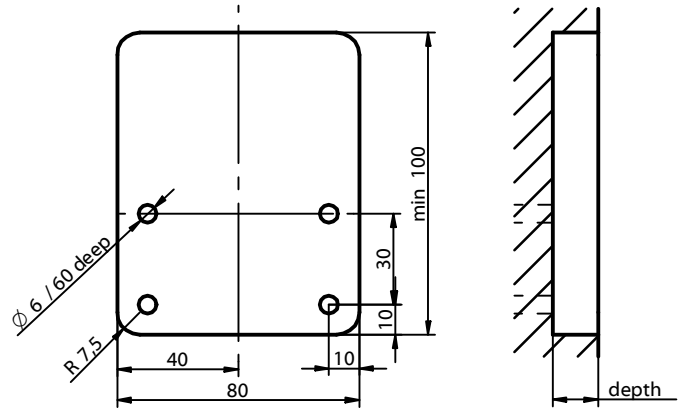


Cutting depth can be selected as required or screw on flat

2. Marking connector position with scribing jig

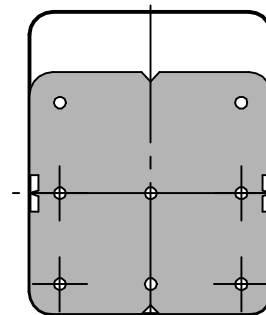


Art. - No. K579

3. Assemble connector

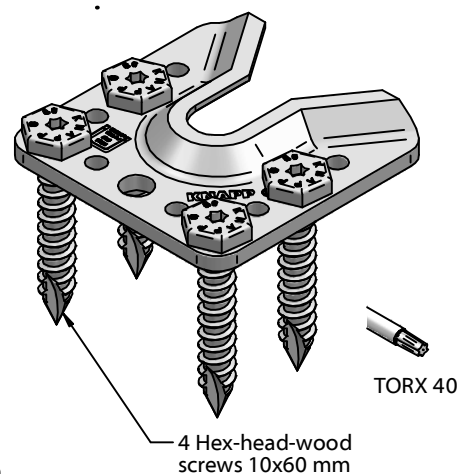

This drawing is the exclusive property of Knapp GmbH.

© Knapp GmbH. All measures in mm - Errors excepted. VERSION 08.08.2018

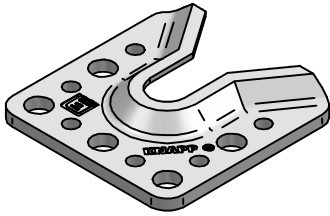


WALCO® 80 M16 / V80

Wall connector for modular design


WALCO 80 M16

 Art. - No. K712/Set



1. Machined edge


Minimum milled dimension

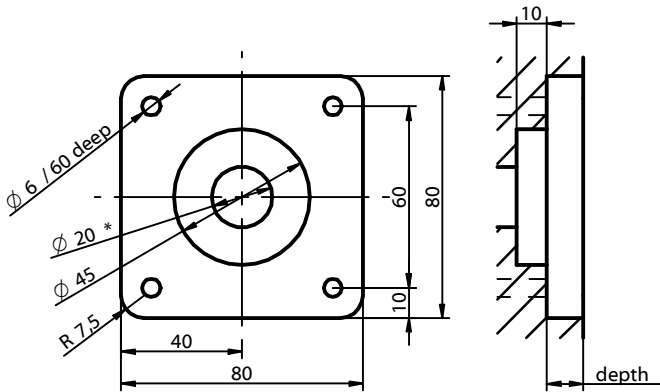

Cutting depth can be selected as required or screw on flat


*... Adjust the drilling depth to the adjustment range / length of the screw!

2. Marking connector position with scribing jig

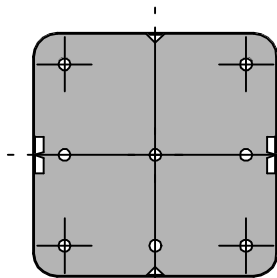

Art. - No. K579


3. Assemble connector

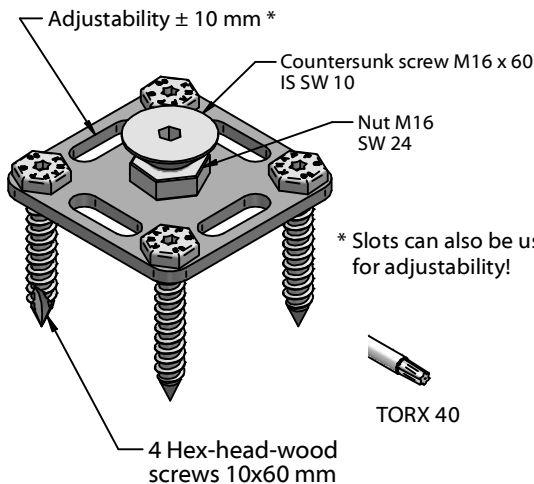

* Slots can also be used for adjustability!

TORX 40

1 connection contains Set K712 and Set K101

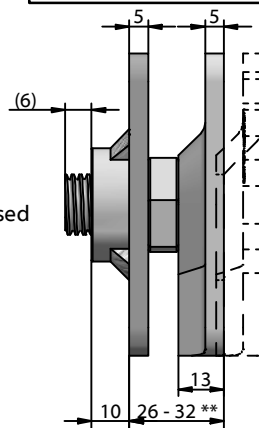

**... dimension example refers to countersunk screw M16 x 40 mm

WALCO V 80


Art. - No. K101/Set



1. Machined edge


Minimum milled dimension

* at one-sided cut-out
** at two-sided cut-out

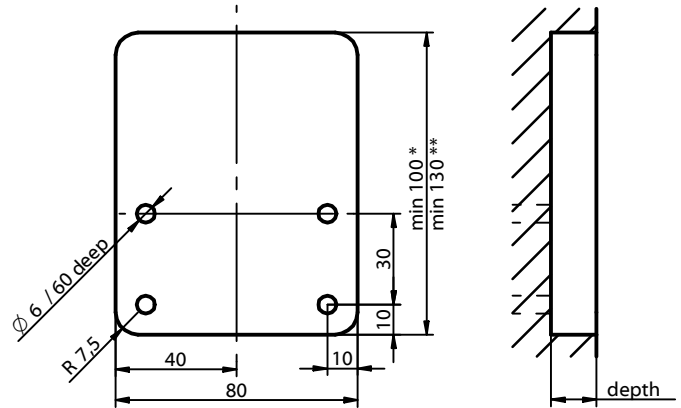


Cutting depth can be selected as required or screw on flat

2. Marking connector position with scribing jig

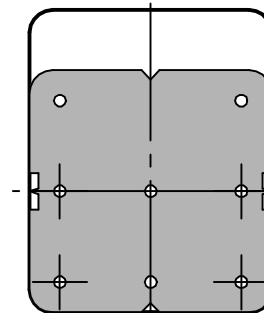

Art. - No. K579

3. Assemble connector

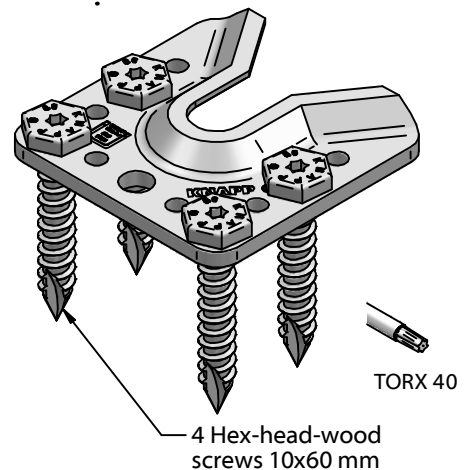

TORX 40

This drawing is the exclusive property of Knapp GmbH.

© Knapp GmbH. All measures in mm - Errors excepted. VERSION 08.08.2018